


LISTA DE RECAMBIOS / DIBUJO

**MAQUINA FLEJADORA PARA FLEJE
DE PLASTICO CON ACUMULADOR
MODELO P331 A/A**

43.0293.01

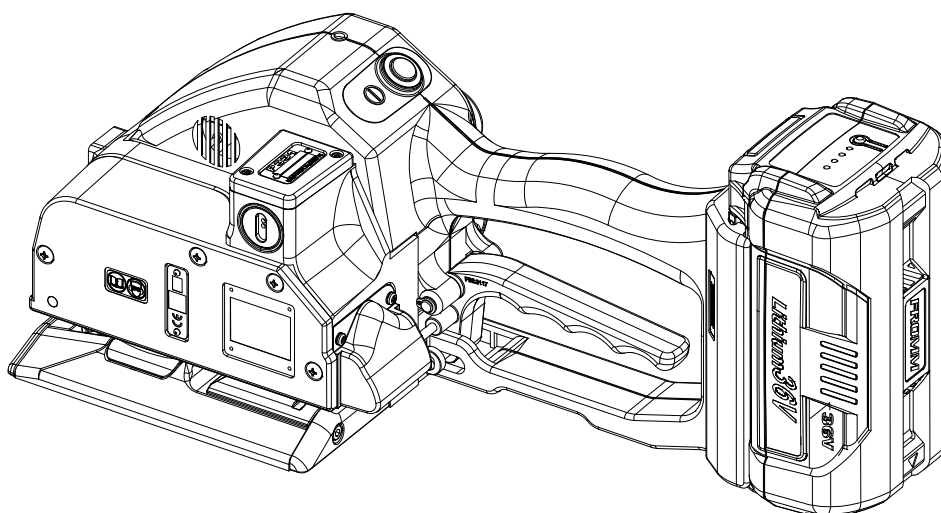

| | Índice | Página |
|----------|--------------------------------------|---------------|
| 1 | Lista de recambios 43.0293.01 | 2 |
| 2 | Dibujo 43.0293.01 | 6 |

1 Lista de recambios 43.0293.01

| 43.0293.01 | P331/32/0.60-0.79/7.0/A | | P331.0002.01 | | | 21.04.2020 |
|------------|-------------------------|----------|--------------|------------------------------|---------------------|------------|
| Art.n° | | en grupo | Pcs. | Descripción | Medidas | Campo |
| N1.1168 | | | 3 | TORNILLO | M5 X 16 | D6 |
| N1.1305 | | | 6 | TORNILLO | M4 X 7.8 | C1+ |
| N1.1553 | | P35.0227 | 1 | TORNILLO DE CABEZA HEXAGONAL | M4 X 8 | B12 |
| N1.1919 | | | 1 | TORNILLO | M4 X 16 | A6 |
| N1.1924 | | | 1 | TORNILLO | M4 X 65 | B6 |
| N1.1927 | | P33.0213 | 1 | TORNILLO CILINDRICO | M4 X 60 | D19 |
| N1.1932 | | | 2 | TORNILLO CILINDRICO | M3 X 8 | A10 |
| N1.1932 | | P33.0213 | 2 | TORNILLO CILINDRICO | M3 X 8 | B9 |
| N1.1934 | | P33.0213 | 3 | TORNILLO CILINDRICO | M4 X 50 | D19 |
| N1.1965 | | | 2 | TORNILLO | M4 X 45 | B6 |
| N1.1966 | | P33.0213 | 1 | TORNILLO | M4 X 70 | D19 |
| N1.2189 | | P35.0214 | 3 | TORNILLO AVELLANADO | M4 X 20 | D13 |
| N1.2212 | | P33.0208 | 4 | TORNILLO AVELLANADO | M4 X 25 | D14 |
| N1.2222 | | | 2 | TORNILLO AVELLANADO | M4 X 10 | C1 |
| N1.6331 | | P33.0213 | 3 | ANILLO DISTANCIADOR | 6 X 12 X 0.5 | A23+ |
| N1.6384 | | P33.0208 | 1 | ANILLO DISTANCIADOR | 11 X 17 X 0.5 | C17 |
| N1.6503 | | | 3 | ARANDELA DE SEGURIDAD | M5 | D5 |
| N1.6504 | | | 10 | ARANDELA DE SEGURIDAD | M4 | C1+ |
| N1.6504 | | P33.0213 | 5 | ARANDELA DE SEGURIDAD | M4 | D19+ |
| N1.6504 | | P35.0227 | 1 | ARANDELA DE SEGURIDAD | M4 | B12 |
| N1.6505 | | | 2 | ARANDELA DE SEGURIDAD | M3 | A9 |
| N1.6505 | | P33.0213 | 2 | ARANDELA DE SEGURIDAD | M3 | C9 |
| N1.7211 | | P33.0213 | 9 | TORNILLO PT | 3 X 20 | C19+ |
| N1.7221 | | P33.0213 | 2 | TORNILLO PT | 2.5 X 14 | C22 |
| N11.1116 | | | 2 | TORNILLO | M4 X 12 | A3 |
| N2.1118 | | P33.0213 | 2 | ANILLO DE SEGURIDAD | 6 | A23+ |
| N2.1121 | | | 1 | ANILLO DE SEGURIDAD | 5 | B12 |
| N2.1121 | | P33.0213 | 1 | ANILLO DE SEGURIDAD | 5 | C9 |
| N2.1606 | | P33.0213 | 1 | ANILLO ELAST.DE RET. | SW6 | C19 |
| N2.1614 | | P33.0208 | 1 | ANILLO ELAST.DE RET. | | C14 |
| N2.2110 | | P33.0201 | 1 | PASADOR CILINDRICO | 4 m6 X 10 | D8 |
| N2.2119 | | P35.0226 | 1 | PASADOR CILINDRICO | 4 m6 X 18 | D4 |
| N2.2147 | | P33.0201 | 2 | PASADOR CILINDRICO | 3 m6 X 10 | C2 |
| N2.2149 | | P33.0213 | 1 | PASADOR CILINDRICO | 4 h6 X 22 | B16 |
| N2.2162 | | | 2 | PASADOR CILINDRICO | 3 m6 X 24 | B11+ |
| N2.2165 | | P33.0206 | 1 | PASADOR CILINDRICO | 4 m6 X 34 | C16 |
| N2.2172 | | P33.0207 | 1 | PASADOR CILINDRICO | 5 m6 X 30 | B15 |
| N2.2187 | | P33.0201 | 1 | PASADOR CILINDRICO | 3 m6 X 6 | C8 |
| N2.2190 | | P33.0213 | 1 | PASADOR CILINDRICO | 6 h6 X 18 | C18 |
| N2.2443 | | P33.0203 | 1 | PASADOR DE SUJECION | 4 X 15 | A7 |
| N2.2465 | | P33.0213 | 1 | PASADOR DE SUJECION | 1.5 X 8 | A23 |
| N2.3364 | | P33.0213 | 1 | RESORTE DE AJUSTE | 2 X 2 X 6 | A24 |
| N2.4902 | | | 4 | TORN.CON CAB.DE MART. | 1.85 X 4.76 | B5+ |
| N2.5157 | | P33.0213 | 2 | RESORTE DE COMPRESIÓN | 0.6 X 4.8 X 20/15.5 | B8 |
| N2.5178 | | | 2 | RESORTE DE COMPRESIÓN | 0.32X2.82X20.5/20.5 | C12 |
| N2.5296 | | P33.0208 | 1 | RESORTE DE COMPRESIÓN | 0.5 X 4 X 24/16.5 | C16 |
| N21.2106 | | P33.0207 | 3 | PASADOR CILINDRICO | 8 h6 X 50 | B3 |
| N21.2130 | | P35.0214 | 3 | PASADOR CILINDRICO | 5 h6 X 20 | C14 |
| N21.5124 | | P33.0213 | 1 | RESORTE DE COMPRESIÓN | 0.9 X 10 X 15/5.5 | A20 |
| N21.5207 | | P33.0213 | 1 | RESORTE DE COMPRESIÓN | 0.5 X 4.5 X 31/20.5 | B14 |

[] = Grupo

* = Piezas con desgaste

| 43.0293.01 | P331/32/0.60-0.79/7.0/A | | | P331.0002.01 | | 21.04.2020 |
|------------|-------------------------|----------|------|--------------------------|------------------------|------------|
| Art.n° | | en grupo | Pcs. | Descripción | Medidas | Campo |
| N21.5211 | | | 1 | RESORTE DE COMPRESIÓN | 0.75 X 4.5 X 24/15.5 | C11 |
| N21.5216 | | P33.0203 | 1 | RESORTE DE COMPRESIÓN | 2.8 X 15 X 34.5/7.5 | B8 |
| N21.5217 | | P33.0213 | 1 | RESORTE DE COMPRESIÓN | 1.25 X 9.5 X 46.5/15.5 | B15 |
| N3.1134 | | P33.0202 | 1 | RODAMIENTO DE BOLAS | 7 X 22 X7 | A15 |
| N3.1134 | | P33.0213 | 1 | RODAMIENTO DE BOLAS | 7 X 22 X7 | A16 |
| N3.1159 | | P33.0204 | 1 | RODAMIENTO DE BOLAS | 6 X 19 X 6 | B17 |
| N3.1160 | | P35.0213 | 1 | RODAMIENTO DE BOLAS | 40 X 52 X 7 | B15 |
| N3.1174 | | | 1 | RODAMIENTO DE BOLAS | 7 X 19 X 6 | C5 |
| N3.1702 | | P33.0213 | 6 | BOLA | 4 MM | C10 |
| N3.2106 | | P35.0214 | 3 | COJINETE DE AGUJAS | K 5 X 8 X 10 TN | C14 |
| N3.2111 | | | 6 | COJINETE DE AGUJAS | K 8 X 11 X 10 TV | B3 |
| N3.2347 | | P35.0202 | 2 | CASQUILLO DE AGUJAS | 10 X 14 X 12 | A15+ |
| N3.3103 | | P35.0226 | 1 | COJIN.DE DESLIZAM. | 10 X 12 X 20 | D5 |
| N3.3166 | | P33.0207 | 1 | COJIN.DE DESLIZAM. | 10 X 12 X 12 | B17 |
| N3.3189 | | P33.0201 | 1 | COJIN.DE DESLIZAM. | 8 X 10 X 8 | C7 |
| N3.3318 | | P33.0205 | 1 | COJIN.DE DESLIZAM. | 8 X 10 X 4 | D16 |
| N3.4509 | * | P33.0209 | 1 | AGUJAS A RUEDA LIBRE | 6 X 10 X 15 | D23 |
| N3.4509 | * | P33.0210 | 1 | AGUJAS A RUEDA LIBRE | 6 X 10 X 15 | C21 |
| N3.4519 | | P35.0217 | 1 | PINON LIBRE | 8 X 12 X 22 | C17 |
| N31.1118 | | P33.0213 | 2 | RODAMIENTO DE BOLAS | 10 X 19 X 5 | C23 |
| N31.1120 | | P33.0213 | 1 | RODAMIENTO DE BOLAS | 4 X 11 X 4 | C22 |
| N31.1121 | | P35.0218 | 1 | RODAMIENTO DE BOLAS | 45 X 58 X 7 | D16 |
| N31.1145 | | P35.0214 | 1 | RODAMIENTO DE BOLAS | 45 X 55 X 6 | C14 |
| N31.1148 | | | 2 | RODAMIENTO DE BOLAS | 40 X 52 X 7 | B3+ |
| N31.1151 | | P33.0213 | 2 | RODAMIENTO DE BOLAS | 17 X 30 X 7 | D23 |
| N31.1163 | | P33.0210 | 1 | RODAMIENTO DE BOLAS | 15 X 24 X 5 | D21 |
| N31.3111 | | P33.0201 | 1 | COJIN.DE DESLIZAM. | 20 X 23 X 10 | C9 |
| N4.9159 | | | 1 | ETIQUETA | <<CE>> | B5 |
| N43.9181 | | | 1 | ETIQUETA | 20 X 10 X 0.1 | B5 |
| N44.9104 | | P33.2151 | 1 | ETIQUETA | <<FROMM>> | D21 |
| N44.9139 | | P33.2111 | 1 | ETIQUETA | 36V | A22 |
| N44.9139 | | P33.2151 | 1 | ETIQUETA | 36V | B19 |
| N44.9169 | | P33.2151 | 1 | ETIQUETA | | D19 |
| N44.9185 | | | 1 | ETIQUETA | | A10 |
| N44.9191 | | P33.2111 | 1 | ETIQUETA | | A22 |
| N5.1193 | * | P33.0213 | 1 | MOTOR REDUCTOR | | B20 |
| N5.2382 | | P33.2120 | 1 | MICRO INTERRUPTOR | | C23 |
| N5.2702 | | P33.0213 | 1 | TAPA | | D20 |
| N51.2129 | | P33.2008 | 1 | TAPON ROSCADO | | B20 |
| N51.2129 | | P33.2010 | 1 | TAPON ROSCADO | | B20 |
| N51.2199 | | N51.1110 | 3 | TAPON ROSCADO | | C22 |
| N51.5464 | | P33.0213 | 1 | VENTILADOR | | C23 |
| N51.5477 | | P33.2111 | 1 | | | B22 |
| N6.6224 | | P33.0213 | 2 | ANILLO-O | 24 X 2 | C21 |
| N6.6232 | | P33.0213 | 1 | ANILLO-O | 8 X 2 | B20 |
| N61.6220 | | P33.0213 | 4 | ANILLO-O | 29.5 X 3 | D23 |
| P31.1124 | | P33.0201 | 1 | TUBO | | B14 |
| P32.1022 | | P33.0202 | 1 | EXCENTRICA SOLDADOR | | A15 |
| P32.1027 | | P33.0213 | 1 | COJINETE DE BOLAS | | C10 |
| P32.1029 | | P33.0213 | 1 | PIEZA DE PRESION | | C10 |
| P32.1251 | | P35.0227 | 1 | PASADOR | | B12 |
| P32.2009 | | P33.2138 | 2 | BOTON GIRATORIO CON RAYA | | C20 |

[] = Grupo

* = Piezas con desgaste

| 43.0293.01 | P331/32/0.60-0.79/7.0/A | | P331.0002.01 | | 21.04.2020 |
|------------|-------------------------|------|-----------------------------|---------|------------|
| Art.n° | en grupo | Pcs. | Descripción | Medidas | Campo |
| P32.2012 | P33.0213 | 1 | GUIA | | B16 |
| P32.2016 | P33.0204 | 1 | RUEDA DENTADA | | B18 |
| [P33.0201] | P33.0213 | 1 | CAJA | | B7 |
| [P33.0202] | P33.0213 | 1 | EXCENTRICA SOLDADOR | | A15 |
| [P33.0203] | P33.0213 | 1 | HUSILLO | | B7 |
| [P33.0204] | P33.0213 | 1 | RUEDA DENTADA | | B18 |
| [P33.0205] | P33.0208 | 1 | TAPA DE ENGRANAJE | | C15 |
| [P33.0206] | P33.0208 | 1 | ASIDERO | | C16 |
| [P33.0207] | P33.0208 | 1 | CAJA ENGRANAJE | | B17 |
| [P33.0208] | P33.0213 | 1 | ENGRANAJE | | B14+ |
| [P33.0209] | P33.0213 | 1 | PINON | | D23 |
| [P33.0210] | P33.0213 | 1 | RUEDA DENTADA | | C22 |
| P33.0211 | * P33.0213 | 1 | MOTOR | | D22 |
| [P33.0213] | | 1 | MODELO BASE | | D6+ |
| P33.1236 | | 1 | PERNO DE GUIA | | D12 |
| P33.1237 | | 1 | PERNO DE GUIA | | D12 |
| P33.2102 | P33.0201 | 1 | CAJA | | D7 |
| P33.2103 | P33.0201 | 1 | PERNO | | A18 |
| P33.2104 | P33.0202 | 1 | PINON | | A15 |
| P33.2105 | P33.0203 | 1 | HUSILLO | | B8 |
| P33.2106 | P33.0203 | 1 | CORREDERA DEL RESORTE | | A8 |
| P33.2107 | P33.0213 | 1 | SOPORTE | | A23 |
| P33.2108 | P33.0205 | 1 | TAPA DE ENGRANAJE | | D15 |
| P33.2109 | P33.0207 | 1 | CAJA ENGRANAJE | | B16 |
| [P33.2111] | P33.0213 | 1 | CAJA DE MOTOR | | A22 |
| P33.2115 | P33.2138 | 1 | BOTON GIRATORIO CON RAYA | | C20 |
| P33.2117 | P33.0213 | 1 | ASIDERO | | B21 |
| [P33.2120] | P33.0213 | 1 | INTERRUPTOR | | A21 |
| P33.2122 | P33.0209 | 1 | PINON | | D23 |
| P33.2123 | P33.0210 | 1 | RUEDA DENTADA | | C21 |
| P33.2124 | P33.0213 | 1 | PINON | | C22 |
| P33.2127 | N51.1110 | 3 | TUBO FLEXIBLE | | C22 |
| P33.2130 | P33.0213 | 1 | ARBOL EXCENTRICO | | C9 |
| P33.2131 | P33.0213 | 1 | RUEDA DENTADA | | A23 |
| P33.2132 | P33.0213 | 1 | TAPA | | B9 |
| P33.2133 | P33.0213 | 1 | PASADOR | | B14 |
| P33.2135 | P33.0213 | 1 | PIEZA DE INSERTATION | | A20 |
| P33.2136 | P33.0213 | 1 | TAPA | | A20 |
| P33.2137 | P33.0213 | 1 | EYE DE ASIDERO | | C19 |
| [P33.2138] | P33.0213 | 1 | ELECTRONICA | 36V | B21 |
| P33.2139 | | 1 | PIEZAS INTERCALADA DE ACERO | | D9 |
| P33.2142 | | 1 | CASQUILLO DE CENTRAJE | | C12 |
| P33.2143 | | 1 | TAPA | | A4 |
| P33.2145 | P33.0213 | 1 | DISCO | | B22 |
| P33.2150 | | 1 | GUIA CINTA | | D4 |
| [P33.2151] | P33.0213 | 1 | CAJA DE MOTOR | | B19 |
| P33.2155 | P33.0213 | 1 | VAINA | | C22 |
| P33.2230 | * | 1 | ROLLO DE TENSOR | | C4 |
| [P35.0202] | P33.0213 | 1 | BASCULA | | A15 |
| [P35.0213] | P33.0208 | 1 | RUEDA DENTADA | | B15 |
| [P35.0214] | P33.0208 | 1 | RUEDA | | C13 |
| [P35.0217] | P33.0208 | 1 | RUEDA CATALINA | | C17 |

[] = Grupo

* = Piezas con desgaste

| 43.0293.01 | P331/32/0.60-0.79/7.0/A | | | P331.0002.01 | | 21.04.2020 |
|------------|-------------------------|----------|------|-----------------------|---------|------------|
| Art.n° | | en grupo | Pcs. | Descripción | Medidas | Campo |
| [P35.0218] | | P33.0208 | 1 | RUEDA DENTADA | | D16 |
| [P35.0226] | | | 1 | PLANCHA DEL COJINETE | | D4 |
| [P35.0227] | | | 1 | PASADOR | | B12 |
| P35.4104 | * | | 1 | BALIZA DE SOLDADURA | | D9 |
| P35.4105 | | | 1 | PLACA DE GUIA CINTA | | A3 |
| P35.4106 | | P35.0202 | 1 | BASCULA | | A16 |
| P35.4107 | * | P33.0213 | 1 | MORDAZA DE SOLDADURA | | D10 |
| P35.4110 | | P33.0213 | 1 | PERNO DE ARRASTRE | | C11 |
| P35.4111 | | P33.0213 | 2 | ARRASTRADOR | | D10+ |
| P35.4150 | | P35.0213 | 1 | RUEDA DENTADA | | B15 |
| P35.4151 | | P35.0214 | 1 | RUEDA DENTADA | | C13 |
| P35.4154 | | P35.0214 | 1 | PORTAPINON | | C14 |
| P35.4155 | | P35.0214 | 3 | PINON | | C13 |
| P35.4156 | | P33.0206 | 1 | ASIDERO | | C16 |
| P35.4159 | | P35.0217 | 1 | RUEDA DENTADA | | C17 |
| P35.4160 | | P35.0218 | 1 | RUEDA DENTADA | | D16 |
| P35.4184 | | | 1 | SOPORTE DE LA MORDAZA | | C3 |
| P35.4188 | * | | 1 | MORDAZA DE SUJECCION | | D3 |
| P35.4189 | * | | 1 | MORDAZA DE SUJECCION | | D3 |
| P35.4190 | * | | 1 | MORDAZA DE SUJECCION | | D3 |
| P35.4192 | | | 1 | TOPE DE CINTA | | B1 |
| P35.4196 | | | 3 | PINON | | B4 |
| P35.4197 | | P35.0226 | 1 | PLANCHA DEL COJINETE | | D4 |
| P35.4198 | * | | 1 | CHUCHILLA | | C11 |
| P35.4199 | | | 1 | GUIA | | C11 |
| P35.4201 | | | 1 | CAJA DE GUIA | | C12 |
| P35.4203 | | | 1 | ASIDERO BASCULANTE | | C12 |
| P35.4204 | | | 1 | ASIDERO BASCULANTE | | B11 |
| P35.4205 | | P35.0227 | 1 | PIEZA DE PRESION | | B12 |
| P35.4210 | | P33.0213 | 1 | PERNO | | D11 |
| P35.4213 | | | 1 | TAPA | | C9 |

[] = Grupo

* = Piezas con desgaste

2 Dibujo 43.0293.01

